


	Sidem Nr.	Reference nr.
Audi Tie rod end	37630	4F0 419 811 E

Original:

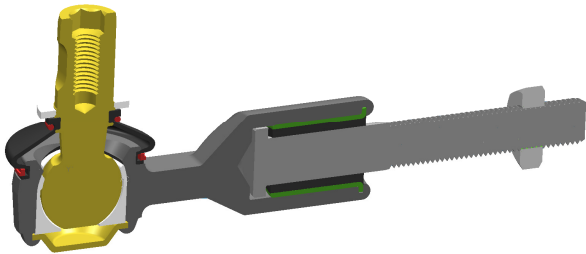

Problem:

- Play on Ball joint
- Silent block tears out

Solution:

- To prevent water-infiltration a new dustcover is designed with a perfect fit along the rod.
- A new rod is designed with an improved neck shape to ensure tight closing of the dustcover during movement.
- Extreme dynamic strain causes early damage of the metal rubber bonding, the design of the inner bushing is Modified to improve load capacity.

Improved:

